



**Suregrip Logi-Pull Mig Series
OWNER'S HANDBOOK**

Parker Logi-Pull Mig Welding Torch Owner's handbook



Serial number and product warranty code

Contents of this box

- Logi- Pull mig welding torch.
- Operation instructions
- Voltage supply board
- Liner cutter
- Liner sharpener
- PA liner
- 1.2mm Drive Roller

Product supplied by



Basic product data and conformity information

Basic product data to IEC/EN60974-7

Process: This is a Logi-Pull-Mig/Mag welding torch

Guidance: This is a manually guided product

Voltage rating: 113V Peak value

Rating: Please refer to the specification sheet for your model.

Gas: Argon, Argon, CO₂ and mixed gas

Torch length: 8 meters.

Wear parts: Have been supplied in accordance with your order and the torch part number.

Type of cooling: Either Gas (air) or water-cooled in accordance with your order.

Rating of electrical controls incorporated in the torch: The switch is rated at 1A/250V AC

Conformity information



A sample of this product has been tested and found to be in conformity with the following standards

- IEC/ EN 60974-7 Arc welding equipment Part 7 Torches
- Low voltage amendment to LVD 2014/35/EU
- Supporting documentation in accordance with EN ISO/IEC 17050-2:2004
- RoHS2 compliance to 2011/65/EU, amend 2015/863/EU
- REACH compliance to 1907/2006/EC
- Manufacturing systems to ISO 9001: 2015





Important Safety Instructions

Read all instructions before using this product.

PARKER TORCHOLOGY LOGI-PULL-MIG torches are safe products to use, but like all modern tools, they can be dangerous in untrained hands. Therefore we have assumed that you know how to use these products, and know the dangers of misuse. These Pull-Mig torches have the ability to inflict serious injuries if used by untrained personnel.

You must never point these products at anyone and operate the trigger.

We strongly recommend that you are completely conversant with Pull- Mig welding techniques before you use this product. If you do not know, or are unsure, then you must contact your dealer or a trained person for advice.

Pacemaker users.

All welding operations give off some form of magnetic and electrical interference; If you have a Pacemaker or some other medical device controlled by an electric current, we recommend you consult your doctor before using any welding or cutting equipment.

Thank you for purchasing a PARKER TORCHOLOGY LOGI-PULL-MIG welding torch. The torch has been made under the most stringent manufacturing conditions and the following will explain how it works together with some easy set up instructions to get you going.

The PARKER TORCHOLOGY LOGI-PULL-MIG torch is designed to act as a “power assist” to the main wire drive system. Wire is pushed from the main drive is passed across a motorized drive roll and a pressure roll. A tension knob exerts pressure on these two rolls so that the drive roll motor pulls the wire.

The tension knob is designed to exert sufficient sideways load on the drive roll to ensure that the motor speed slows down to match the main wire drive speed, whilst still exerting sufficient pulling power to feed the wire at a uniform rate. This tension knob is factory pre-set. We do not recommend changing this tension.

The torch has conventional industry standard machine connections, but before connecting your torch, check that your machine is equipped to take Pull- Mig torches. If the machine is not equipped then you will need to fit the Voltage Supply Board that is supplied with the torch. With this arrangement wire speed is optimized from the machine.

The torch is supplied with a 7 wire open-ended trigger/speed control lead and we recommend the fitting of a suitable plug/socket arrangement to facilitate connections to the welding machine by a suitably qualified person.

Pull-mig torches are supplied with either 24V or 42V motors depending on your order specification.

This Handbook is laid out to given an overview of the torch, its control system and set-up guides .

Introduction to the Uniarc Logi-Pull-Mig Torch and system.

Traditional Mig Pull welding torches are only controlled by the on/off function which is operated through the torch trigger.

Changes to other welding functions, e.g. amps, volts, arc length and so on, can only be made by constant reference by the welder to the welding power source.

This can be both time consuming and inconvenient.

A further major disadvantage is that the welder has to interrupt the welding process in order to make these changes.

Logi-Pull Mig torches move the welding functions and controls from the welding power source to the torch handle by housing those functions within a purpose built module, ergonomically contoured and designed into the welding torch handle.



The Parker Torchology Logi-Pull Mig torch has the ability to save programs as "Job's".

These jobs are given a numerical reference (or job number) and are stored in the welding machines memory. To take advantage of this feature, the welding machine must have the facility to store data.

The Logi-Pull Mig gun is supplied in one of two variants. A Two- button or a Four-button. These modules can control from two to three functions. These functions can only be changed whilst the welding process is off.

These control modules are fully interchangeable. Contact our sales office for further details if you wish to change from a Two-button to a Four- button set up.

The following text details the functions available with examples of the control options and their use.

Logi-Pull Two-button module (LM1)

The Logi-Pull Mig torch is designed for "off-arc" operation and values are generally changed prior to welding. The welding functions to be controlled are set within the welding power source prior to connecting the Torch.

Functions: Job mode, up/down control

Depending on the chosen welding power source set up, LM1 (Two button module) can control up to two welding functions. Pressing both front and rear buttons simultaneously will change those welding functions.

Any changes to any function can only be made at the start or end of the welding process, and all control functions are default set to be inoperable whilst welding.

Example

In this example we will assume the welder has selected job number, and volts as the functions he wants to control, with job number as the default setting.

- Pressing the front and rear buttons will increase / decrease the job number.
- By simultaneously pressing both buttons the function mode can be changed from job number to volts.
- Pressing the front / rear buttons will now increase/decrease the volts setting.
- By simultaneously pressing both buttons once more, the function mode can be changed back to job number.



Logi-Pull Four-button module (LM2)

Functions: Job mode up/down control, x 2

Depending on the chosen welding power source set up, LM2 (Four-button module) can control up to three welding functions. Any changes to any function can only be made at the start or end of the welding process, and all control functions are default set to be inoperable whilst welding.

Example

In this example we will assume the welder has selected job number, amps and volts as the functions he wants to control.

- Pressing the front and rear buttons are default set to increase / decrease the job number.
- Pressing the upper and lower buttons will increase / decrease the volts.
- By simultaneously pressing both upper and lower buttons the function mode can be changed from volts to amps.
- Pressing the upper and lower buttons will now increase / decrease the amperage setting.
- By simultaneously pressing both upper and lower buttons once more, the function mode of the front and rear buttons can be changed back to volts.



Drive head set up

Setting up the Pull-Mig torch is a simple process but before starting check that you have the correct drive roll for the wire you will be using. The size is marked on the drive roll.

Main components of the drive head.

- 1 Pressure roll
- 2 Pull-Mig Handle cover
- 3 Drive roll
- 4 Tension knob
- 5 Pressure arm
- 6 Neck liner nipple



To set up.

- Before starting make sure that the end of the welding wire has been dressed and burrs and sharp edges removed to prevent internal scoring of the torch liner
- Open the Pull-Mig Handle cover
- Unscrew the tension knob
- Open the pressure arm assembly
- Toggle feed the wire from the machine until it emerges from the liner.
- Carefully and slowly feed the wire into the neck liner nipple.
- Close the pressure arm assembly.
- Tighten the tension knob so it is fully wound down and locked into position
- Close the handle cover

The pressure arm is factory set to deliver the correct amount of side force to the drive roll. We do not recommend changing this setting.

Water-cooled Pull – Mig torches.

If you have purchased a Water-Cooled variant, the water connections are industry standard and are marked blue (showing the cold water inlet) and red (showing the hot water outlet)

We recommend a good quality water coolant additive is added to the cooling fluid, this will enhance cooling through the torch body and will prolong torch hose life. It will also prevent frost damage to the torch internal components.

When first connecting a water-cooled variant, run the cooler before you weld to remove any trapped air pockets and remember to check the water levels in the cooler after this startup check. An average 8m torch will hold around 0.5 liters of coolant. After welding, we recommend that you run the water cooler for at least one minute to cool all the torch's internal components. When removing a water-cooled torch from a recirculator and to prevent loss of coolant from the torch, use the red and blue stoppers that are supplied. We recommend draining the torch of coolant if it is not going to be used for any length of time.

You will require a water cooler (recirculator) with the following specification:

- Minimum water flow : 1.2 l/m
- Minimum inlet pressure :2.0 bar
- Minimum cooling capacity :1600W
- Maximum inlet pressure 5.0 bar
- Maximum water inlet temperature 50 degrees C

We strongly recommend that a flow switch be fitted to the return side of the recirculator and wired in series with the torch trigger. This flow switch will shut down the system and give torch protection should the water flow rate drop below 1.2 Litres per minute. (72 Litres per hour)

Water-Cooled neck assemblies

Water-Cooled Torch necks are supplied with a location pin. The purpose of this pin is to lock the neck in a positive position. The location pin registers in one of eight equi-spaced holes drilled in the neck seat.

If a different position is required to one of those eight pre-set positions, the pin can be removed but it must be removed with the Torch coolant drained from the torch. A gentle pull on the pin will remove it.

Once the pin is removed and the neck refitted, the neck can be rotated to different positions by gently loosening the lock nut and moving the neck to the new position. Care should be taken not to pull the neck out of the body whilst rotating. Pulling the neck from the body will break the O-ring water seal and Torch coolant will be lost.

Air-Cooled and Water –Cooled neck assemblies

The locking nut supplied with the neck assembly is designed to provide the correct pressure to the seating. It is tightened to 2.5Nm. Care should be taken not to over tighten the nut because this may damage the neck seat.

Drive Roll replacement.

Drive Rolls can be supplied in sizes to suit 0.8, 0.9, 1.0, 1.2 and 1.6 diameter wire sizes. Your torch will have been supplied with a standard 1.2 drive roll suitable for soft wires unless a different size has been specified on your order. Drive rolls can be supplied for Hard wires these have a Vee groove, or soft wires with a U groove.

They are replaced by inserting a screwdriver blade into the drive shaft, whilst at the same time applying spanner force in an anti-clockwise direction to unscrew the drive roll from the shaft.

The drive rolls are supplied with a left-hand thread and are double grooved to add service life to each roll.

The unused groove can be used by inverting the drive roll.

Liner replacement.

Liners will give a good service life if maintained at regular intervals. This is done by clearing debris and dust from the Liner with a clean and dry air supply inserted into the Liner. Wet air will corrode the internal surface of the liner.

It is best to blow the liner from the wire entry point of the liner because during operation, debris and dust is generally carried forward towards the neck end of the Liner. Blowing from the opposite direction will push the debris into the Liner.

When a liner is due for replacement there are a number of points to note.




Steel Liner replacement

- Lay the torch out straight, ensuring it is not twisted.
- Unscrew the Liner nut and remove the old Liner.
- Uncoil the new liner and feed it into the torch until resistance is felt. You can also check the Liner has reached the end of its travel by viewing the liner end through the viewing holes in the liner nipple.
- Measure the excess liner sticking out from the rear-end and remove the Liner
- Cut off the excess liner material but leave an extra 5mm of liner. This added 5mm to the Liner length will ensure the liner is always under slight compression within the torch.
- Grind the cut end to an inclusive angle of 40 degrees; the liner cut end must be ground to an inclusive angle of 40 degrees to ensure the liner beds into the front end fittings.
- Gently feed the Liner into the torch taking care not to bend or “kink” the liner and re-tighten the Liner nut.

Teflon or PA Liner replacement


- Lay the torch out straight, ensuring it is not twisted.
- Unscrew the Liner retaining nut 2 and remove the old Liner.
- Uncoil the new liner 5, and use the Liner sharpener supplied to cut the end to a 40-degree inclusive angle. This is to ensure the minimum clearance between the liner and the liner nipple
- Gently feed the Liner into the torch taking care not to bend or “kink” the liner until resistance is felt. You can also check the Liner has reached the end of its travel by viewing the liner end through the viewing holes in the liner nipple.
- Slide the clamping collet 4, O-ring 3, and Liner retaining nut 2 over the new liner 5, re-assemble the liner retaining nut and tighten.
- Measure the excess liner sticking out from the rear-end to the machine drive rolls and cut the liner directly in front of the wire feeder drive rolls 1. Cut this end and using the Liner sharpener supplied, cut a 40-degree inclusive angle to give the closest clearance to the drive rolls.

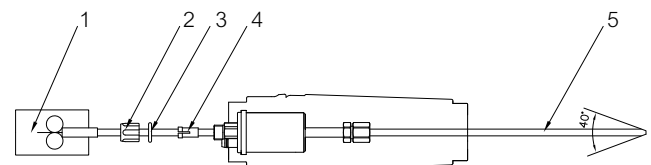

- | | |
|-----------------|------------|
| 1 DRIVE ROLLS | 4 CLAMPING |
| 2 RETAINING NUT | 5 TEFLON |
| OR PA LINER | |
| 3 O-RING | |


Swan Neck Water-Cooled neck liners.

- Unscrew and remove the Swan neck assembly 3 from the torch.
- Remove the old neck liner and replace with the new liner 1.
- Replacement liners are supplied cut to length and ground to 40 degrees. They do not need adjustment and can be used straight from the package.
- Refit the liner and nipple to the swan neck and re-assemble the swan neck to the torch tightening the retaining nut to 2.5Nm.

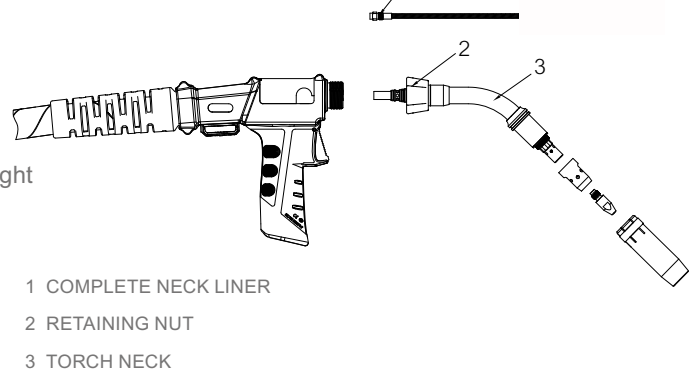


Swan Neck Air-Cooled neck liners.

- Unscrew and remove the swan neck assembly 4 from the torch.
- Unscrew the moulded neck liner nipple 1. This will withdraw the neck liner from the neck.
- Unscrew the old neck liner from the moulded liner nipple 1. It is a conventional right hand thread and will easily unscrew.
- Replace the new neck liner by screwing it into the nipple through approximately 2 to 3 turns.
- Refit the liner and nipple to the swan neck and re-assemble the swan neck to the torch tightening the moulded nut retaining to 2.5Nm.

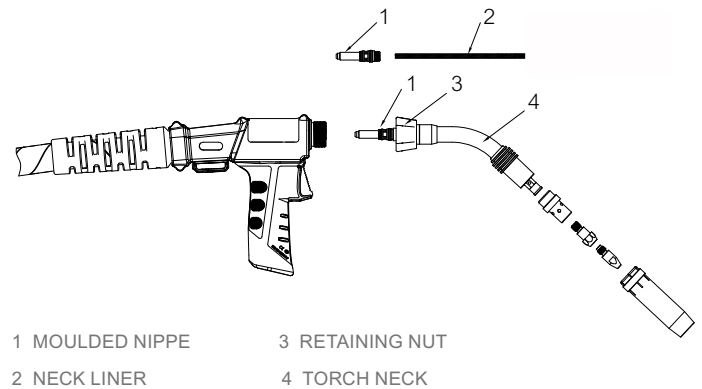

Appendix "A"

Typical Pull-mig wiring diagram.

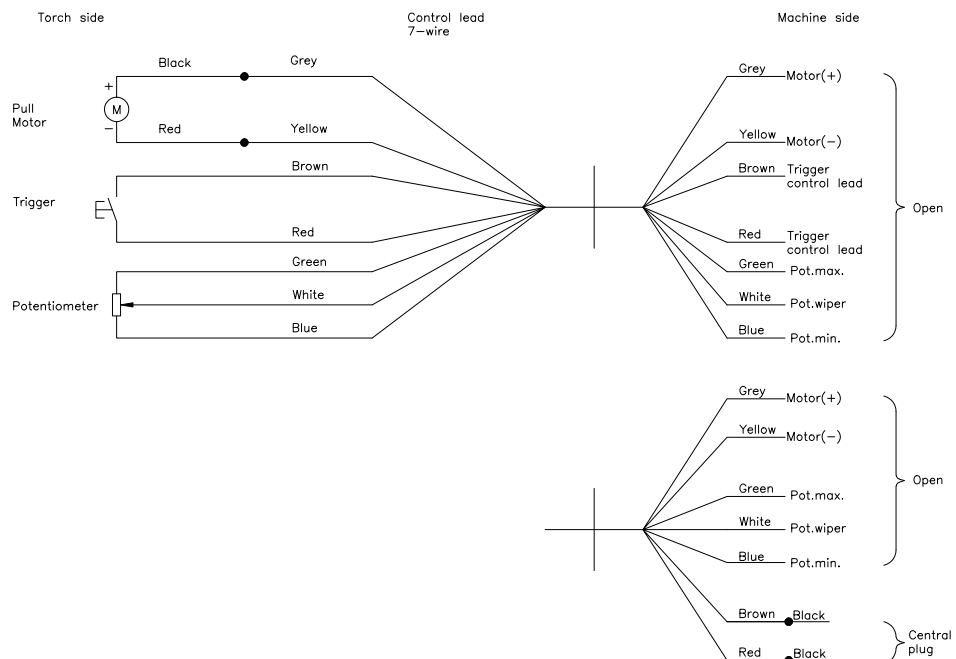



Maintenance, Fault Finding and Warranty.

Maintenance, Fault Finding and Warranty.

Used correctly, you can expect a long life from a Parker Pull-Mig- MIG torch, but in order to ensure this long life, there are a few common sense precautions you should take note of when using and servicing your torch.

We would recommend that you should pay attention to the following:

O Ring care

Swan necks are fitted with O-rings to seal both water and gas channels. The condition of these rings is critical to the smooth operation of a Parker Torchology Pull-Mig torch. Damage to these O-rings may affect the weld performance.

Great care should always be taken when removing or replacing the neck. Each time the neck is withdrawn from the body, the O-rings should be inspected. If any wear or damage is suspected, the O-rings must be replaced.

Any suitable lubricant designed for O-Ring assembly should always be applied to the O-rings whenever the neck is removed, or when fitting replacement O-rings. When applying lubricant, care should be taken not to block any of the gas or water passage holes.

Front end consumables

The nozzle, contact tip and diffuser all run at very high temperatures and you should regularly inspect them for wear and operational damage. When changing a contact tip, always use a contact tip spanner to prevent over tightening. Repeated over tightening will destroy the threads in the tip adaptor.

Drive Rolls

Always make sure you have the correct drive roll for the type and size wire you are using and note that the drive roll threads are left-hand and the drive roll can be inverted to double its life.

The drive roll and pressure roll should be inspected regularly for wear. Run the gun in a quiet place, without wire feeding and listen for any unusual noises. You can eliminate pressure roll from drive roll noise by releasing the pressure arm. If you suspect something is wrong, you should contact your distributor or dealer.

The area around the drive roll should be regularly dusted off to prevent dust and workshop debris from accumulating. We do not recommend lubricating the drive shaft or pressure roll. These are sealed for life units and lubrication oils or greases will only pick up dust and turn these oils and greases into a grinding paste. A simple dust off is all that is required.

The gearbox, drive motor and shaft top bearing are also sealed for life. No maintenance is required.

PARKER TORCHOLOGY PULL-MIG Warranty

Every PARKER TORCHOLOGY PULL-MIG welding torch is manufactured to the highest standards and carries a 3 month warranty from the date of sale to the end user. The warranty covers and is limited to, a fault developing as a result of faulty workmanship or faulty materials.

What is covered?

- Defective materials used in the manufacture of the product.
- Faulty workmanship in the manufacture of the product.

What is not covered?

- Incorrect use or damage.
- Normal wear and tear to either the product or the consumables supplied with the product.
- Faults arising from using non-Parker spare parts.
- Direct or indirect costs of any form arising as a result of a suspected, or actual, defective product.

How to make a claim.

This warranty is limited to the original purchaser of the product, it is not transferable. If a fault is suspected, the dealer or ourselves must be contacted and informed of the fault before the product is returned.

You can contact us by

✉ Mail: sales@ParkerTorchology.com.cn

☎ Phone: 0086 531 88239823

📠 Fax: 0086 531 88239398

How will we handle any claim?

Parker's sales office may ask you to return the product with a copy of your proof of purchase, (If you are the end user) or a copy of proof of sale (If you are a distributor).

Depending on the nature of the claim, we may ask one of our

technical staff to discuss the problem with you to get a quick resolution.

Once the cause of the problem is established and at our discretion, we will either repair or replace the defective product free of charge.

We will refund the costs incurred in returning the product if a defect is found, but will only refund normal transport costs. We will not pay for UPS, Express deliveries or any other high speed carriers.

If we believe the product failure is as a result of any reason other than defective materials or manufacture, we will issue a written report to you detailing our findings.

Other issues.

Whilst Pull-Mig welding torches will give long and lasting service, we do understand the harsh and demanding working environment in which our products operate, therefore Parker retain the right to deal with any fault in a manner that best suits Parker.

This warranty is an addition to Parker's standard terms and conditions and Parker's standard Terms and Conditions of Sale will take precedence over this warranty.



JINAN UNIARC WELDING TECHNOLOGY CO., LTD
13A Zhangjin Comprehensive Bonded Zone
33688, Jing Shi Dong Road
Jinan Area of China (Shandong) Pilot Free Trade Zone
Jinan 250102, P.R. China

Tel: +86 531 88239823

Website: www.uniarctorchology.com

Email: info@uniarctorchology.com

V.2024.05

Form ref: MN_PARKER_LOGIPULL_001